

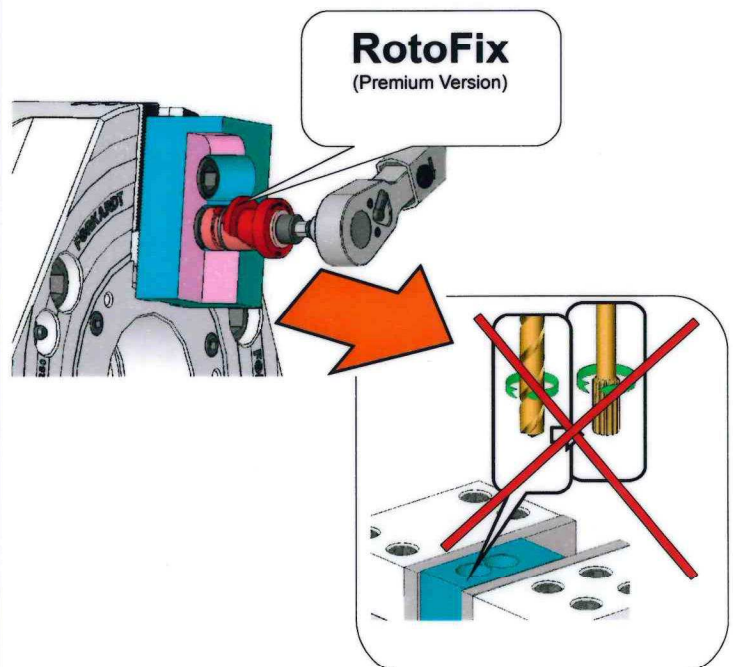
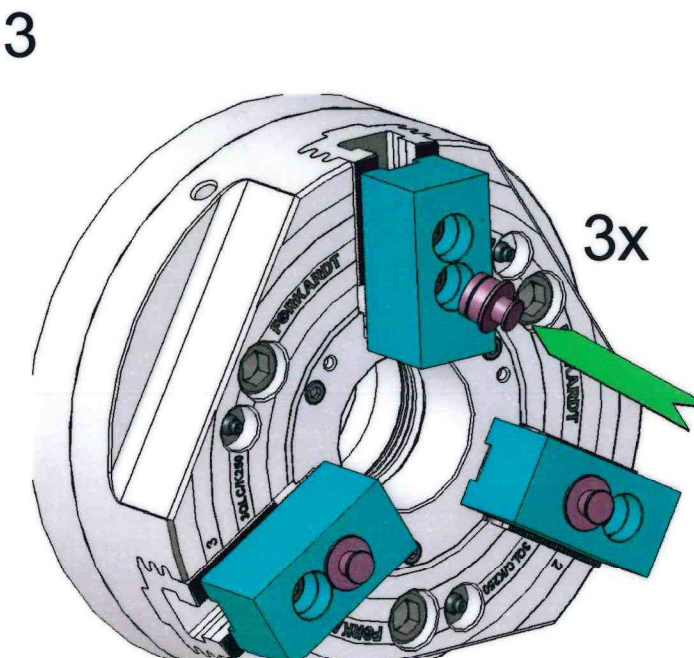
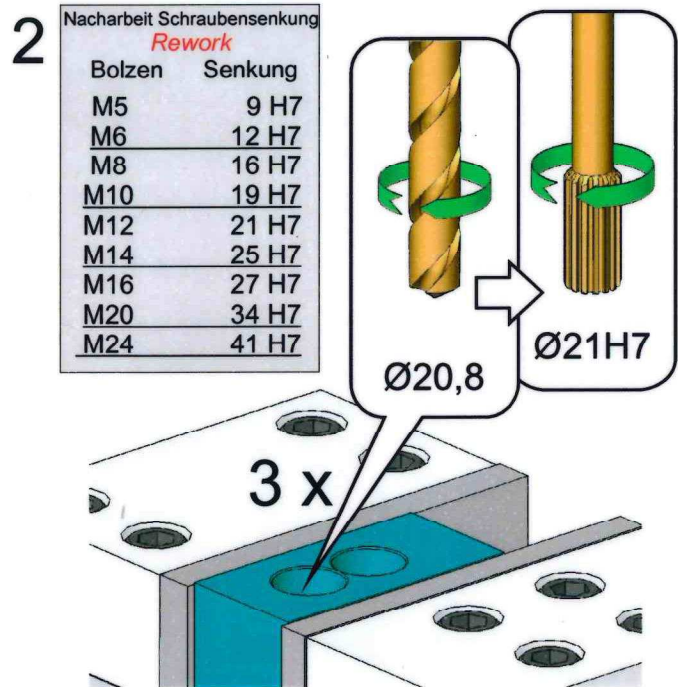
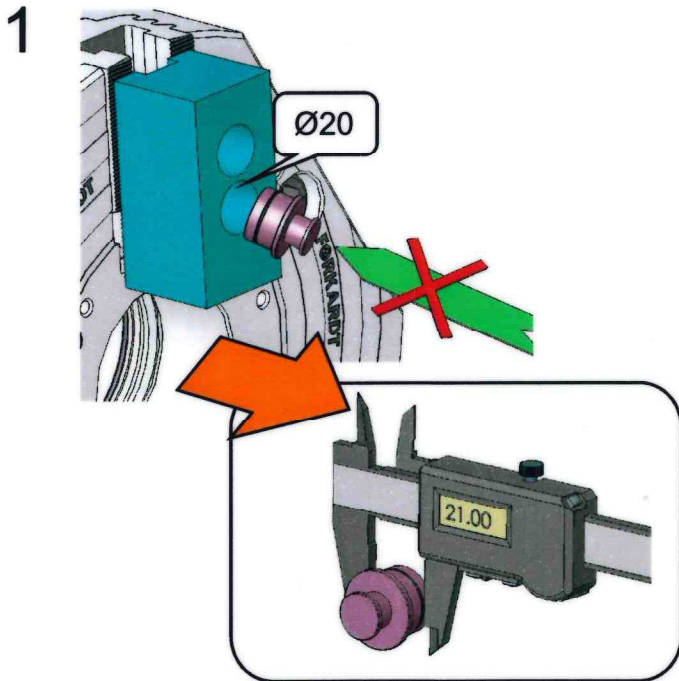
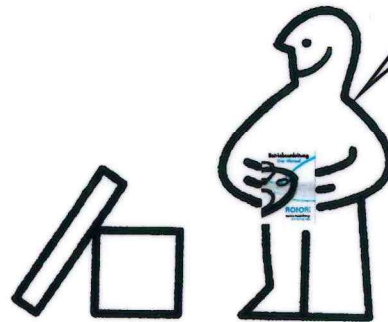


Kurzanleitung RotoRi: S - L - LX - XL - XXL

RotoFix (Premium Version)

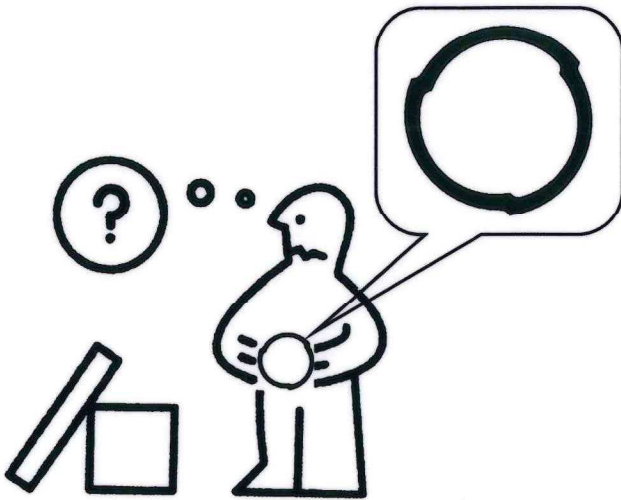

4

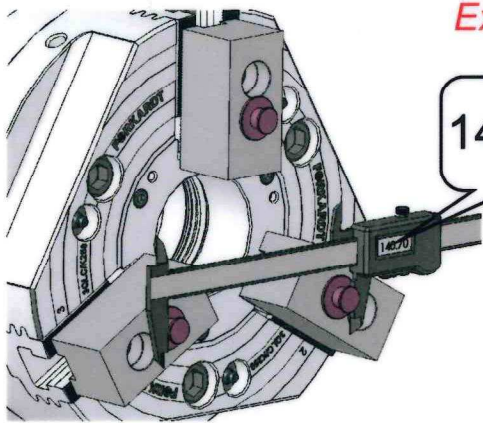

Beispiel
Example

140.70

5

← 23	161 - 168
← 22	154 - 161
← 21	147 - 154
← 20	140 - 147
← 19	134 - 141
← 18	126 - 134
← 17	121 - 126
← 16	116 - 121
← 15	111 - 116

clamping



Ring 20


6



Max. Spannkraft-Ringe
Max. Clamping Force-Rings

Ring-Nr.	F in daN
1 - 10	3.000
11 - 29	4.000
30 - 39	6.500
40 - 52	7.500

8

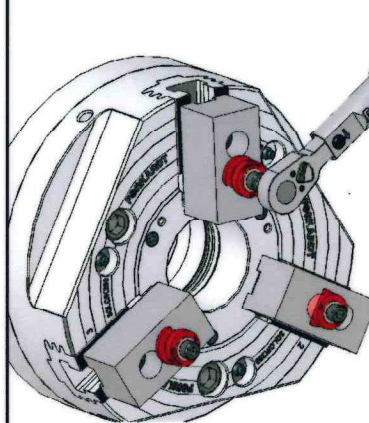

Drehmomente für das
Vorspannen der RotoFix
Torque to prestressing
RotoFix


RotoFix	M in Nm
M5	2
M6	5
M8	15
M10	25
M12	35
M14	35
M16	50
M20	35
M24	80

7

RotoFix
(Premium Version)

Außenspannung
External clamping

Innenspannung
Internal clamping

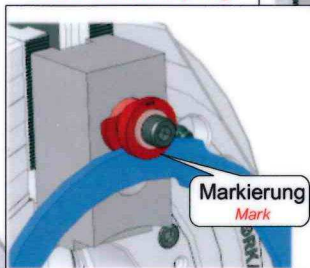

Markierung
Mark



Max. Spannkraft
Max. Clamping force
RotoFix in daN

RotoFix	in daN
M5	1000
M6	1500
M8	3500
M10	3500
M12	4000
M14	4000
M16	5000
M20	5000
M24	6000