




ROTA 2B

**2-jaw power lathe chuck
with long jaw stroke for
clamping fitting parts**

Robust 2-jaw power lathe chuck with long stroke and simultaneous maximum clamping force

The SCHUNK 2-jaw chuck ROTA 2B is particularly suitable for clamping workpieces for which a large interfering contour must be clamped (e.g. for fitting parts). For this purpose, the lathe chuck combines a long jaw stroke with maximum clamping forces. Standard mounting threads allow many ways of mounting workpiece stops or consoles.

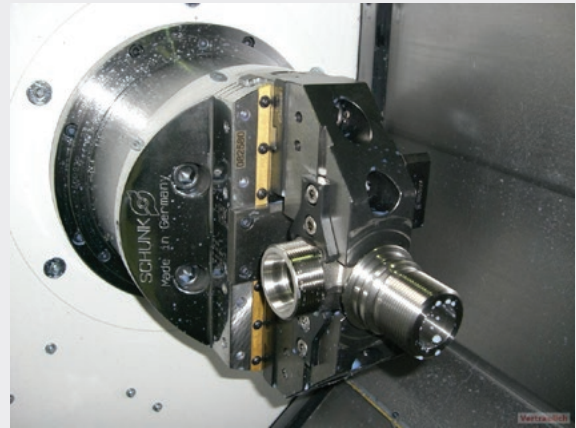

Advantages – Your benefits


- + Precision wedge-hook power lathe chuck for highest quality requirements**
Allows excellent machining results
- + High efficiency of the wedge hook system**
Process-reliable clamping due to high clamping forces
- + Optimum jaw support for O.D. and I.D. clamping due to a very long base jaw guidance**
Allows high clamping forces at a long service life
- + Optimized lubrication system**
Consistently high clamping forces ensured
- + Longest jaw stroke at high jaw clamping force**
Reliable and variable clamping of workpieces over interfering contours
- + Media feed-through (coolant or air) as option integrated in the chuck body**
Flexibility depending on the application
- + Low height design**
Maximum use of the machine room and maximum rigidity of the system
- + Base jaws with fine serration or tongue and groove as standard**
High flexibility in the range of top jaws
- + Low chuck weight**
Fast acceleration and deceleration operations shorten the cycle times
- + All sides of the functional parts are hardened and ground**
Ensures a long service life

Technical data

Description	Max. rotational speed [min ⁻¹]	Max. clamping force [kN]	Max. actuating force [kN]	Stroke/jaw [mm]	Piston stroke [mm]
ROTA 2B 125	5300	26	23	10	17.5
ROTA 2B 160	4000	40	32	12.5	22
ROTA 2B 200	3200	54	45	15	26
ROTA 2B 250	2700	75	61	16	28
ROTA 2B 315	2200	85	68	18	32
ROTA 2B 400	2000	85	68	18	32

Function of ROTA 2B

The axially movable piston transfers the force to the base jaw and generates a radial jaw movement synchronized with the rotational axis.

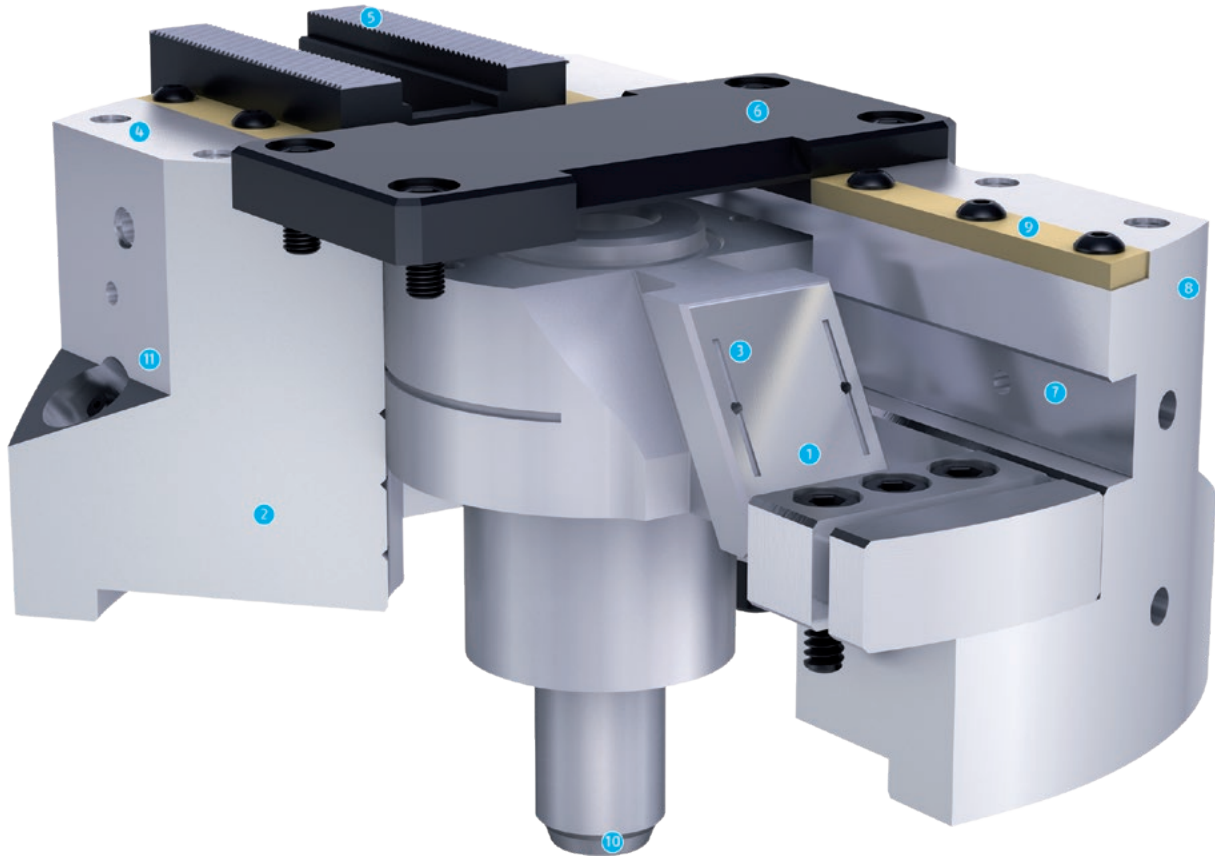


- | | |
|--|---|
| <p>1 Wedge hook drive
Offers constantly high clamping forces in operation</p> <p>2 Hardened and extremely rigid base body
Therefore a longer service life at highest precision. Even with maximum clamping force</p> <p>3 Optimized lubrication system
Consistently high clamping forces ensured</p> <p>4 Mounting thread
For workpiece stops or consoles</p> <p>5 Base jaws with fine serration or tongue and groove as standard
High flexibility in the range of top jaws</p> | <p>6 Cover plate
Is centered via a fitting bore, which can also be used to position various workpiece stops</p> <p>7 Long jaw guidance
Offers optimal support for O.D.- and I.D. clamping</p> <p>8 Low height design
Expands your machine's workspace</p> <p>9 Wiper strips
Seal the base jaw guidances and offer a good protection against coolant and chips</p> <p>10 Central media supply
Available on request for air control or coolant</p> <p>11 Weight-optimized design
For great economy in daily use</p> |
|--|---|

Three standardized jaw interfaces available


Select one standardized jaw interface from the 3 standardized versions and benefit from the fact that existing top jaws can also be used on the new SCHUNK lathe chuck.

- ① **Fine serration**
 - 1/16" x 90°
 - 3/32" x 90°
- ② **Metric tongue and groove**

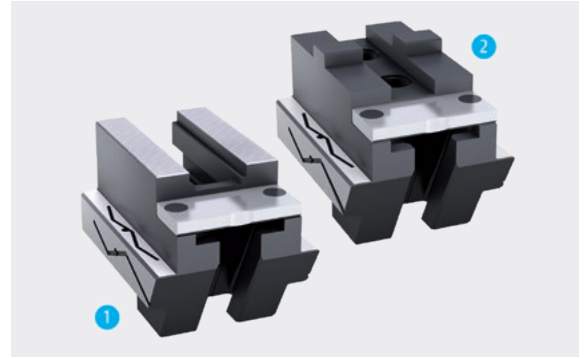

Adjustable brass wiper bars


Adjustable brass wiper bars seal the base jaws to give protection against coolant and chips.

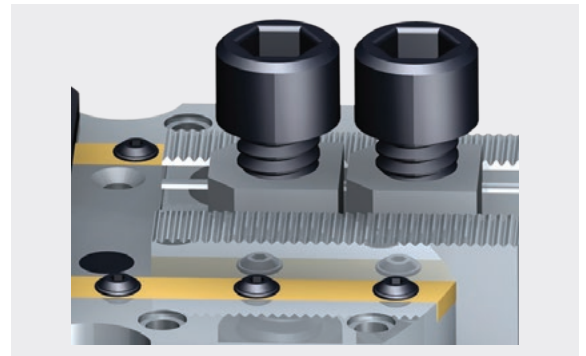


Largest jaw stroke

The extremely large jaw stroke and high clamping force allow clamping over interfering contours. This is particularly useful when clamping fittings.

- ① **Chuck jaw**
- ② **Jaw stroke**
- ③ **Workpiece**

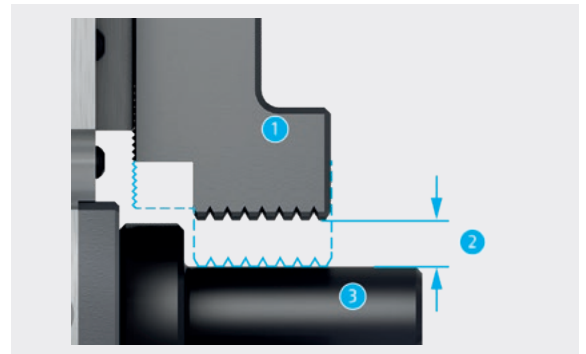

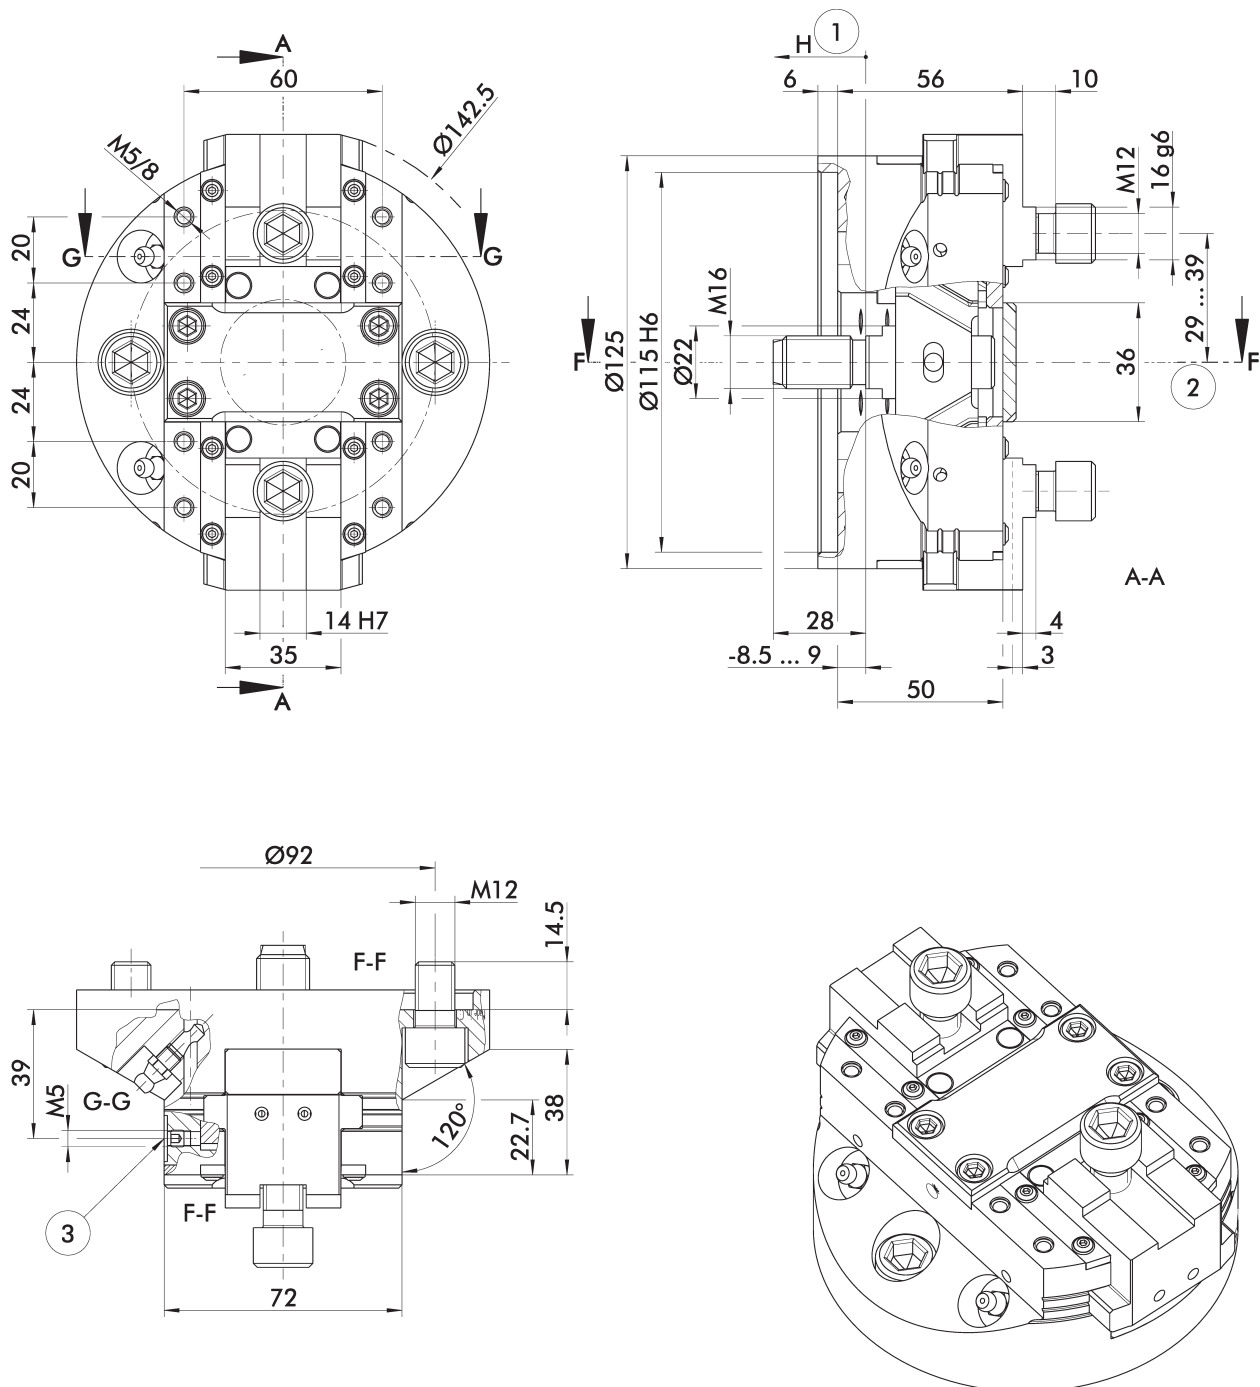

Backstop cylinder side onwards, backwards in the adapter plate.
Subject to technical changes.

- ① Piston stroke direction
- ② Distance to center of tongue and groove
- ③ Air purge connection

Technical data

Spindle type	Spindle size	ID	Serration	Max. rotational speed [min ⁻¹]	Max. clamping force [kN]	Max. actuating force [kN]	Moment of inertia [kgm ²]	Weight [kg]
-	Z115	0813031	Tongue and groove	5300	26	23	0.007	3.7

Scope of delivery

Chuck, T-nuts or mounting screws for top jaws, chuck mounting screws and operating manual

Note


Caution!

Due to the geometry of the base jaws, the ROTA 2B 125 chuck should be used for O.D. clamping only!


Further technical data

Chuck type	Stroke/jaw [mm]	Piston stroke (H) [mm]	Center jaw height [mm]
ROTA 2B 125	10	17.5	68

Clamping force-RPM-diagram

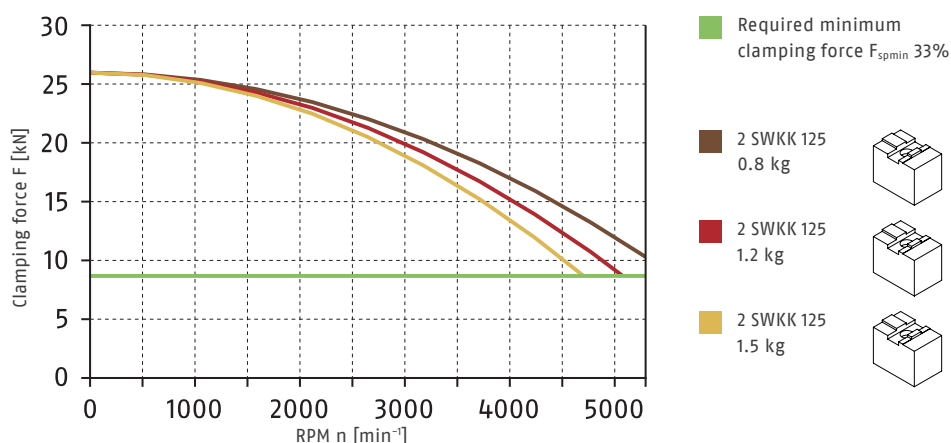


Load of base jaw guidance

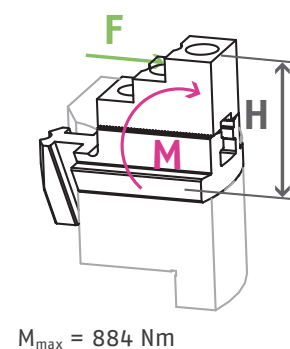

Adapter plates

Z-mount on short taper ISO 702-1

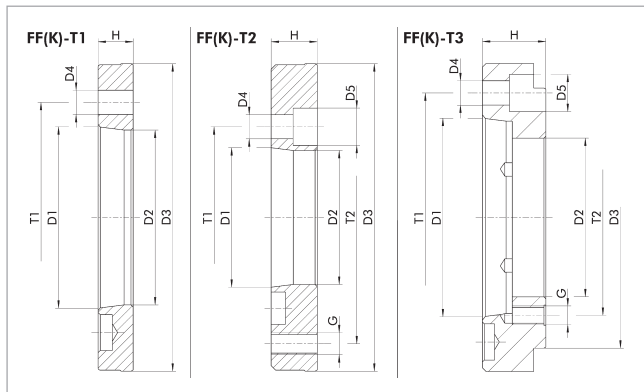

Technical data

Description	Adapter plate type	ID	Suitable for	D1	D2	D3	D4	D5	G	H	T1	T2
					[mm]		[mm]	[mm]		[mm]	[mm]	[mm]
FF-T2 Z115-A3	FF-T2	0806005	ROTA 2B 125	Nr. 3	30	Z115	11 (6x60°)	17	M12 (2 x 180°)	18	70.6	92
FF-T2 Z115-A4	FF-T2	0806006	ROTA 2B 125	Nr. 4	30	Z115	11 (6x60°)	17	M12 (2 x 180°)	18	82.6	92
FF-T3 Z115-A5	FF-T3	0806007	ROTA 2B 125	Nr. 5	72	Z115	11 (6x60°)	18	M12 (2 x 180°)	32	104.8	92

Direct adapter plates

Direct adapter plates are used if the spindle mounting bolt circle has the same size as the lathe chuck mounting bolt circle. The adapter plate has to be mounted on to the spindle together with the lathe chuck. The adapter plate is preassembled on the lathe chuck.

Reduction adapter plates FF-T2


Reduction adapter plates are used if the mounting bolt circle of the spindle is smaller than the one of the lathe chuck mounting bolt circle. The adapter plate is first mounted on the spindle and then the lathe chuck is mounted on the adapter plate.

Expansion adapter plates FF-T3

Expansion adapter plates are used if the mounting bolt circle of the spindle is larger than the one of the lathe chuck mounting bolt circle. The adapter plate is first mounted on the spindle and then the lathe chuck is mounted on the adapter plate.

Soft top jaws

with tongue and groove

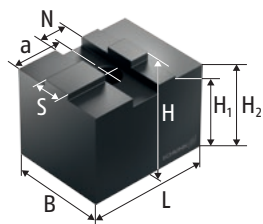

2 SWKK
Soft top jaws

Technical data

Chuck type	Description	ID	N [mm]	S [mm]	B [mm]	H [mm]	H1 [mm]	H2 [mm]	L [mm]	a [mm]	Screws	m/SET
ROTA 2B 125	2 SWKK 125	0126100	16	14	40	48	45.5	45	60	31	M12	1.5

Our complete range of chuck jaws can be found online in our Chuck Jaw Quickfinder and on [schunk.com](https://www.schunk.com)

Accessories

Clamping force tester

For measuring the jaw clamping force of 2, 3 and 6-jaw chucks up to 6,000 RPM.



Suitable for	Description	ID
ROTA 2B 125	IFT Set	1404235

Grease

LINOMAX plus

High-performance grease as standard for regularly lubricating SCHUNK manual and power lathe chucks and steady rests.



Bundle	Description	ID
Cartridge	LINOMAX plus cartridge	1342585
Can	LINOMAX plus can	1342586
Bucket	LINOMAX plus bucket	1342587

Grease gun

Auxiliary tools for lubrication of all kinds of SCHUNK products. The grease gun can be used for cartridges of all types of SCHUNK grease.



Bundle	Description	ID
Cartridge	Grease gun	9900543



**H.-D. SCHUNK GmbH & Co.
Spanntechnik KG**

Lothringer Str. 23
D-88512 Mengen
Tel. +49-7572-7614-1300
Fax +49-7572-7614-1039
CMM@de.schunk.com
schunk.com